



LASER[®]

Gas Soldering Kit

8 Piece

Contents
Soldering iron
Solders tips x 2 (3.4 & 4.8mm)
Solder in plastic dispenser
Tip adaptor
Needle tip
Hot knife tip
Sponge

Instruction

3410



www.lasertools.co.uk

Guarantee



Distributed by The Tool Connection Ltd
Kineton Road, Southam, Warwickshire CV47 0DR
T +44 (0) 1926 815000 F +44 (0) 1926 815888
info@toolconnection.co.uk www.toolconnection.co.uk

If this product fails through faulty materials or workmanship, contact our service department direct on: **+44 (0) 1926 818186**. Normal wear & tear are excluded as are consumable items & abuse.

How to use your Gas Soldering Kit

Filling the Soldering Iron With Gas

Use filtered butane fuel.

Before filling make sure that the knob is pushed to the 'OFF' position (See Fig 1).

Follow the directions on the butane fuel can. Applying the tip of the filler valve to the base of the soldering iron. Using a pumping action, fill the container (See Fig 2).

A complete fill takes about 10 seconds. Allow the gas to stabilise for a few minutes, before lighting the torch.

Assembling

Screw the spring loaded tip adaptor to the soldering iron

Lighting

Push the switch towards the 'ON' position, enough to hear a small 'hissing' sound (See Fig 3).

Push the spring loaded adaptor upwards to expose the burner head through the chrome sleeve

(Circled in Fig 4) then light through the oval hole, release the adaptor to cover the burner, the tip will then heat up.

Storage

Make sure that the torch is switched to its 'OFF' and cool, before storing or leaving unattended.

Caution

- The burn tip and other accessory tips get hot in operation.
- Do not touch the tip or accessories, or place them on flammable objects,
- Always wear safety glasses when using the torch.
- Always have a fire extinguisher, or bucket of water near the torch work area.
- Under no circumstances should you attempt to repair a damaged torch.
- Never attempt to repair or heat a gasoline can, aerosol can or any compressed gas container.
- Use only in well ventilated areas.
- Avoid fumes from fluxes, lead based paint and all metal heating operations.
- Be especially careful to avoid fumes from cadmium plating and galvanised metal.

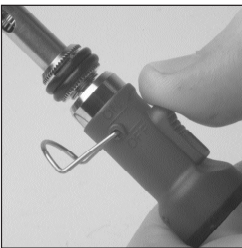


Fig 1



Fig 2



Fig 3

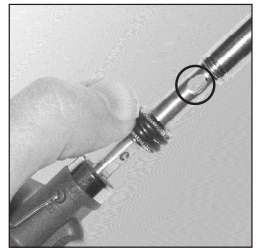


Fig 4

Warning: Keep out of reach of children



Safety First. Be Protected.